



HYUNDAI Technical Service Bulletin

Group	CAMPAIGN
Number	07-01-002
Date	JANUARY, 2007
Model	AZERA (TG)

Subject
**REAR DOOR WAIST LINE MOLDING REPLACEMENT
 (SERVICE CAMPAIGN T35)**


CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

IMPORTANT: DEALERS MUST PERFORM THIS CAMPAIGN ON ALL AFFECTED VEHICLES PRIOR TO CUSTOMER RETAIL DELIVERY AND WHENEVER AN AFFECTED VEHICLE IS IN THE SHOP FOR ANY MAINTENANCE OR REPAIR.

IMPORTANT: WHEN A VEHICLE ARRIVES AT THE SERVICE DEPARTMENT, ACCESS HYUNDAI MOTOR AMERICA'S "WARRANTY VEHICLE INFORMATION" SCREEN VIA DCS ON-LINE TO IDENTIFY OPEN CAMPAIGNS.

DESCRIPTION:

On some Azera vehicles, the stainless steel strip (A) on the rear waist line moldings (B) may separate. This bulletin provides the procedure to replace the rear door waist line moldings with revised parts.

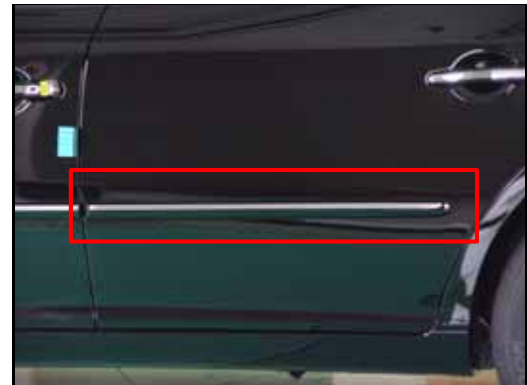

VEHICLES AFFECTED:


Model: Azera (TG)

Affected vehicle production date range: Produced from Jun. 16, 2006 to Dec. 18, 2006

Affected vehicle VIN range:

Produced from KMHFC46F87A132072 to KMHFC46F97A179160

PARTS INFORMATION:

Part Name	Part Number	Picture	Qty
Rear Door Waist Line Molding	87730-3L020 N2 QQH 87730-3L020 EB QQH 87730-3L020 G6 QQH 87730-3L020 B7 QQH 87730-3L020 M9 QQH 87730-3L020 T9 QQH 87730-3L020 Y5 QQH 87730-3L020 F9 QQH 87730-3L020 S7 QQH		1 Kit


NOTE: Refer to the 2-digit PAINT code from the VIN plate located at the lower portion of the driver side B-pillar. Locate the part number with the corresponding paint code in BOLD from the list above. Each kit includes color-code painted waist line molding assemblies for both rear doors.

SERVICE PROCEDURE:

1. Open the RH front door. Insert a trim tool (A) into the gap between the rear door waist line molding and the rear door panel.

WARNING: Be careful not to damage and scratch the door panel.

2. Pull the plastic flap outward carefully.

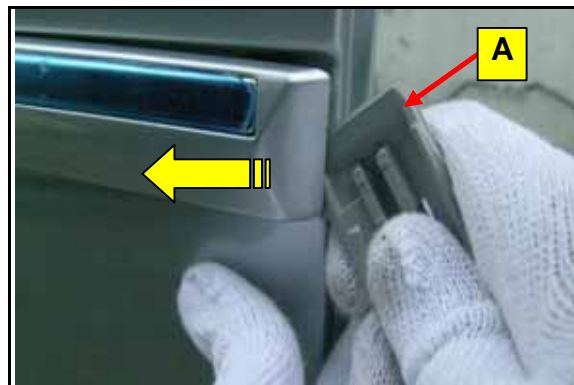

3. When the end of the molding is separated from the door panel, insert your fingers under the molding.





HYUNDAI Technical Service Bulletin

Group

CAMPAIGN

Number


07-01-002

4. Pull and remove the molding from the door panel, moving your fingers from the front to the rear of the molding.




5. After removing the molding, remove the clips (B) which are left on the door panel by rotating them.

NOTE: If a clip falls into the door body, make sure they are removed to prevent rattles.

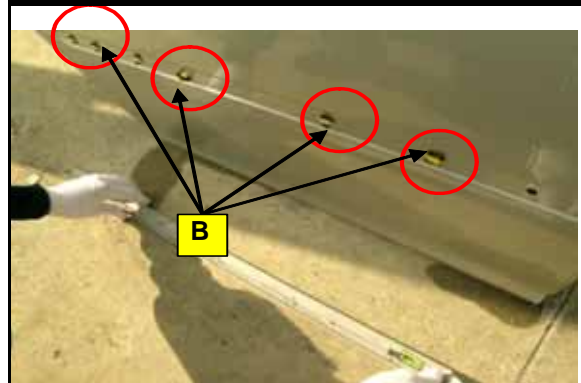

NOTE: All tape residue (C) must be removed before installation of the new part.

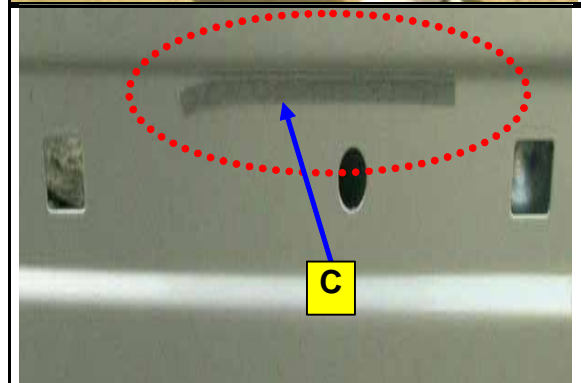

6. Verify that the color code indicated in (D) part of new waist line molding is the same as the exterior body color.

7. Detach the covering paper from the new waist line molding.



8. Place the guide boss (E) of the new molding onto the door panel, then press against the molding to install it beginning at the front edge and moving toward the rear.



9. Repeat steps 1-8 on the LH rear door.

WARRANTY INFORMATION:

Op Code	Operation	Op Time
60B055R1	REAR DOOR WAIST LINE MOLDING REPLACEMENT(BOTH SIDES)	0.2 M/H

NOTE: Submit claim using Campaign Claim Screen.