



HYUNDAI Technical Service Bulletin

Group	CAMPAIGN
Number	08-01-017
Date	NOVEMBER, 2008
Model	2009 AZERA

Subject
**EXTERNAL AMPLIFIER REPLACEMENT
 (SERVICE CAMPAIGN T60)**

CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

IMPORTANT: DEALERS MUST PERFORM THIS CAMPAIGN ON ALL AFFECTED VEHICLES PRIOR TO CUSTOMER RETAIL DELIVERY AND WHENEVER AN AFFECTED VEHICLE IS IN THE SHOP FOR ANY MAINTENANCE OR REPAIR.

IMPORTANT: WHEN A VEHICLE ARRIVES AT THE SERVICE DEPARTMENT, ACCESS HYUNDAI MOTOR AMERICA'S "WARRANTY VEHICLE INFORMATION" SCREEN VIA DCS ON-LINE/WEBDCS TO IDENTIFY OPEN CAMPAIGNS.

DESCRIPTION:

• **Condition**

The audio output on some Azera vehicles may stop intermittently.

• **Countermeasure**

Replace the external amplifier assembly with a new service part using the service procedure outlined in this bulletin.


APPLICABLE VEHICLES:

- **Model** Azera
- **Production Date Range** March 4, 2008 through July 2, 2008

PARTS REQUIRED:

KIT NAME	KIT NUMBER
EXTERNAL AMP ASSEMBLY KIT - AUDIO	96370-3L400QQH

Kit Components

PART NAME	FIGURE	Q'TY
EXTERNAL AMP ASSEMBLY - AUDIO		1 EA
HANGER ASSY - LUGGAGE NET		1EA
TRIM PLUG		3EA
ANCHOR WIRE TIE		1EA



HYUNDAI Technical Service Bulletin

Group

CAMPAIGN

Number

08-01-017

SERVICE PROCEDURE:

1. Open the trunk, and remove the trunk floor carpet and spare tire cover (A).

2. Unbolt the transverse trim mounting bolts (B).




NOTE: The trim has been removed from the vehicle to better show mounting bolt locations.

3. Remove the transverse trim by pulling it straight up.

CAUTION: Be careful not to damage or break trim clips. If any trim clips remain on the body after removing the transverse trim, pull it out of the body and install onto the transverse trim.

4. Unfasten (1) mounting bolt (C) and (2) screws (D) on the right lower side of the luggage trim.

5. Remove (3) trim plugs (E) and the luggage net hanger (F). Then, partially remove the weatherstrip (G) on the right corner of trunk body as shown.

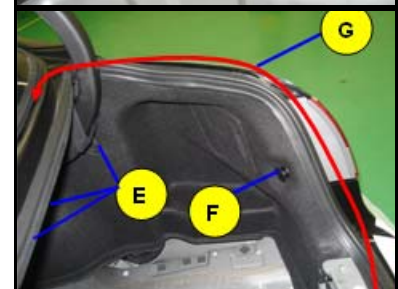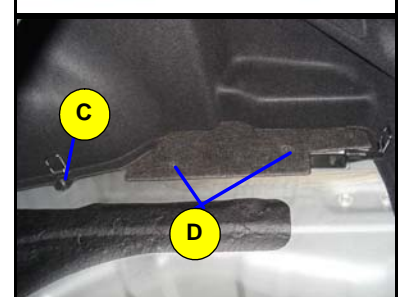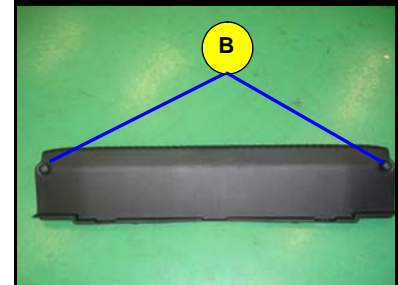

6. Disengage the luggage trim upper hook (H) by pushing up and away from the panel to get access to fasteners. Then, remove fasteners.

7. Pull back the luggage trim as shown on the photo to get access to the external amplifier.

8. Unfasten the (3) amplifier mounting nuts (I) and remove the wire harness connector band cable (J).

9. Disconnect the amplifier harness wiring connectors (K) and remove the amplifier assembly.

10. Install new amplifier supplied in the service kit.

11. Using the new harness band cable supplied in the kit, re-attach harness to body.

12. Install all previously removed components in the reverse order of installation.

13. Test amplifier output by turning on radio and listening to audio system at moderate volume for at least 3 minutes.

14. Procedure complete.



CAMPAIGN CLAIM INFORMATION:

OP CODE	OPERATION	OP TIME
80B030R1	External Amplifier Replacement (Dealer)	0.5 M/H

NOTE: Submit claim using the campaign claim screen