



# HYUNDAI Technical Service Bulletin

|        |                  |
|--------|------------------|
| Group  | CAMPAIGN         |
| Number | 09-01-003        |
| Date   | FEBRUARY, 2009   |
| Model  | 2007 SONATA (NF) |

Subject  
**2007MY SONATA SUN VISOR REPLACEMENT  
 (SERVICE CAMPAIGN T74)**

|   |   |   |  |
|---|---|---|--|
| <b>CIRCULATE TO:</b>                                | <input type="checkbox"/> GENERAL MANAGER            | <input checked="" type="checkbox"/> PARTS MANAGER | <input checked="" type="checkbox"/> TECHNICIAN |
| <input checked="" type="checkbox"/> SERVICE ADVISOR | <input checked="" type="checkbox"/> SERVICE MANAGER | <input checked="" type="checkbox"/> WARRANTY MGR  | <input type="checkbox"/> SALES MANAGER         |


**IMPORTANT: DEALERS MUST PERFORM THIS CAMPAIGN ON ALL AFFECTED VEHICLES WHENEVER AN AFFECTED VEHICLE IS IN THE SHOP FOR ANY MAINTENANCE OR REPAIR.**

**IMPORTANT: CAMPAIGN APPLIES TO VEHICLES LOCATED IN THE WESTERN, PC, AND SOUTHERN REGIONS ONLY. THIS INCLUDES THE STATES AL, AR, AZ, CA, CO, FL, GA, HI, KS, LA, MS, NC, NM, NV, OK, OR, SC, TN, TX UT, AND WA.**

**IMPORTANT: WHEN A VEHICLE ARRIVES AT THE SERVICE DEPARTMENT, ACCESS HYUNDAI MOTOR AMERICA'S "WARRANTY VEHICLE INFORMATION" SCREEN VIA WEBDCS TO IDENTIFY OPEN CAMPAIGNS.**

**DESCRIPTION:**

- Symptom/Condition  
 On some 2007MY Sonata (NF) vehicles, the sun visor pivot arm may crack or may not hold the desired position.

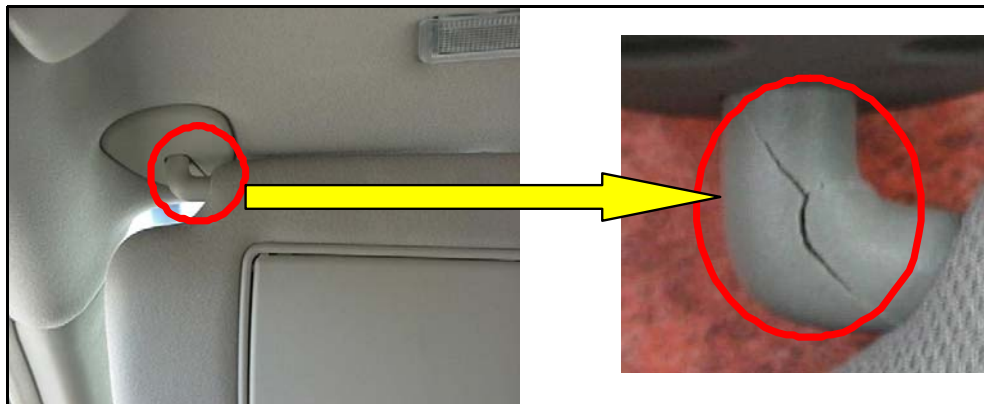

- Countermeasure  
 Replace both left and right sun visor assemblies for customer satisfaction.

**VEHICLES AFFECTED:**

Model: 2007MY Sonata (NF)

Applicable vehicle production date range:

- Produced from Job#1 to March 31, 2007

Applicable VIN range:

**PARTS REQUIRED:**

| Kit Number      | Side      | Color | Sunroof |
|-----------------|-----------|-------|---------|
| 852010A250QDKIT | Driver    | Beige | No      |
|                 | Passenger | Beige | No      |
| 852010A250QSKIT | Driver    | Gray  | No      |
|                 | Passenger | Gray  | No      |
| 852010A750QDKIT | Driver    | Beige | Yes     |
|                 | Passenger | Beige | Yes     |
| 852010A750QSKIT | Driver    | Gray  | Yes     |
|                 | Passenger | Gray  | Yes     |

**NOTE: Kit includes both driver and passenger side sun visors. Please order the respective kit part number. Do not order individual parts.**

**SERVICE PROCEDURE:**

**NOTE: Before conducting procedure, confirm vehicle is within the affected VIN range.**

**CAUTION:**

- Put on gloves to protect your hands.
- Use appropriate plastic trim tool to prevent damage.
- Take care not to bend or scratch the roof trim and caps.


**NOTE: Do not damage or soil interior.**



# HYUNDAI Technical Service Bulletin

|        |           |
|--------|-----------|
| Group  | CAMPAIGN  |
| Number | 09-01-003 |

1. Remove the left sun visor arm cap (A) with appropriate plastic trim tool.

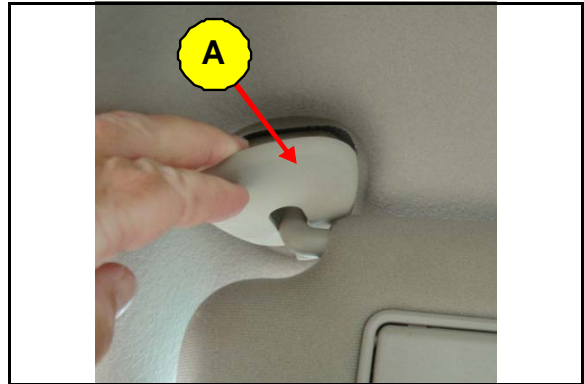

2. Remove both sun visor arm mounting screws.



3. Disconnect the wiring connector (B) and remove the left sun visor assembly.



4. Install a new left sun visor assembly following the removal procedure in reverse order.
5. Repeat steps 1-4 and install a new right side sun visor assembly.
6. Open vanity mirror lid and verify light turns on.

**WARRANTY INFORMATION:**

| OP CODE  | OP NAME                       | OP TIME |
|----------|-------------------------------|---------|
| 90BA03R0 | RH & LH Sun Visor Replacement | 0.2 M/H |

**NOTE: Submit claim on Campaign Entry Screen.**